

Assembly Instructions 2010



scanmagnetics com





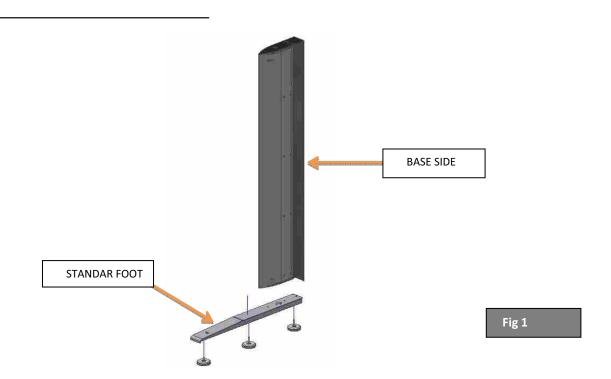


<u>Assembly Instructions – Index</u>

Base Side Assembly Instructions	Chap. 1
Extensible Foot Assembly Instructions	Chap. 2
Frame Assembly Instructions	Chap. 3
Base Side + Frame Assembly Instructions	Chap. 4
Connecting Post Assembly Instructions	Chap. 5
Frame Joint Assembly Instructions	Chap. 6
Stabilizer Assembly Instructions	Chap. 7
Table Assembly Instructions	Chap. 8
Metal Tray Assembly Instructions	Chap. 9
Shelf Assembly Instructions	Chap. 10
Corner Table and Shelf Assembly Instructions	Chap. 11
Duct Assembly Instructions	Chap. 12
19" Support Kit Assembly Instructions	Chap. 13
19" Socket Base Assembly Instructions	Chap. 14
19" Duct Assembly Instructions	Chap. 15
19" Rack Compartment Assembly Instructions	Chap. 16
Compartment Assembly Instructions	Chap. 17
19" Rack Side Assembly Instructions	Chap. 18
Wall Rack Assembly Instructions	Chap. 19
Panel Assembly Instructions	Chap. 20
TFT Support Assembly Instructions	Chap. 21
Console Assembly Instructions	Chap. 22
Console Side Assembly Instructions	Chap. 23
Console Shelf Assembly Instructions	Chap. 24
Console Compartment Assembly Instructions	Chap. 25
ATS Assembly Instructions	Chap. 26









Assembly process

 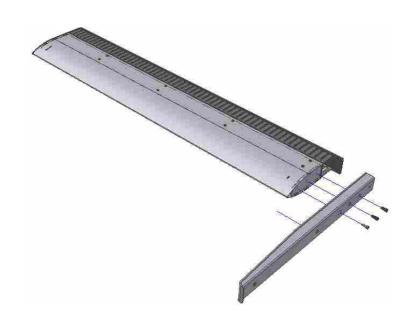Graphic assembly process






STEP 1 – Position the **foot** in the bottom of the **side**. (Fig. 2)

Fig 2






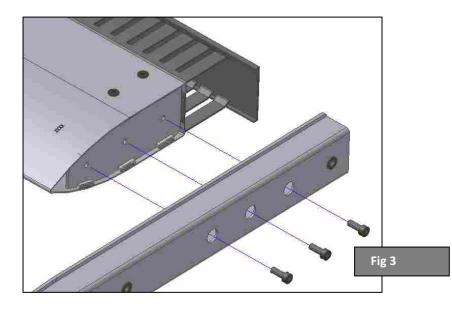
STEP 2 – Screw the **standard foot** tightly on to the **side** with 3 **M8x20 DIN 912 Allen screws + M8 Grover washer** (Fig.3).



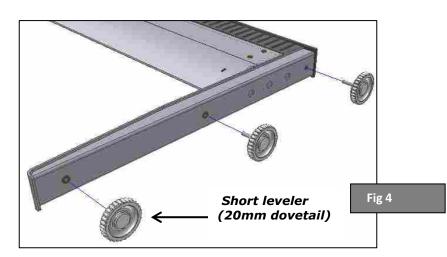STEP 3 – Screw the **levelers** on to the **foot** rivets. Mount the **short leveler**, i.e. the **leveler with 20mm dovetail**, on the front of the **foot**. (Fig. 4)



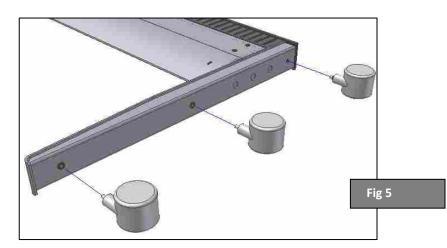
MOBILE SIDE: The only difference in the **mobile base side** is that the **levelers** are replaced by two **wheels.** (Fig. 5)







Extensible Foot Assembly Instructions

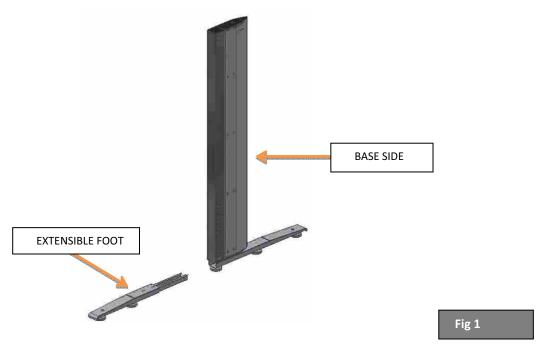


Assembly process

Graphic assembly process



The **extensible foot = two-sided foot.** It can be later assembled in any extension arrangement.

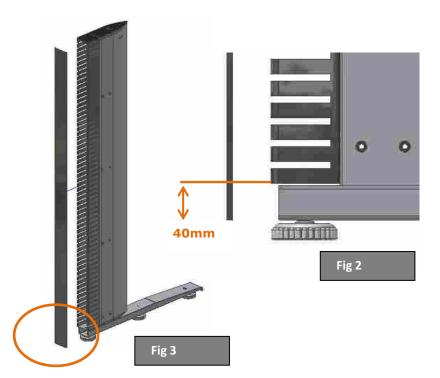
STEP 1 – Before mounting the **extensible foot,** remove the cover from the **vertical wiring duct** of the **base side** (Fig. 3). To mount the **foot,** cut 40mm from the bottom of the PVC cover (Fig. 2).









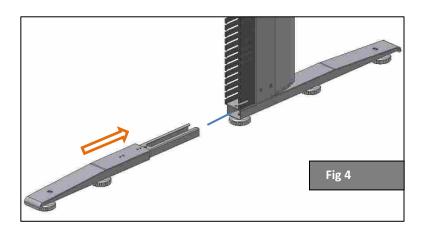 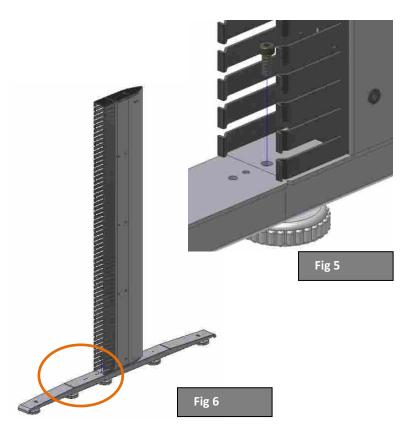STEP 2 – Position the **extensible foot** behind the **standard foot** and insert it fully (Fig.4).

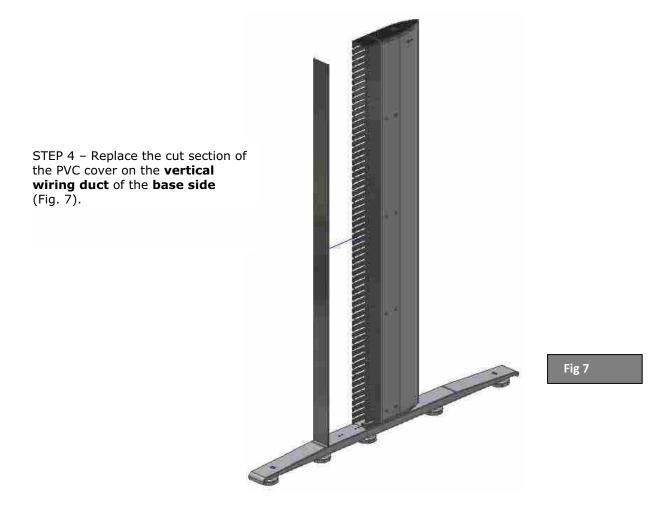


 


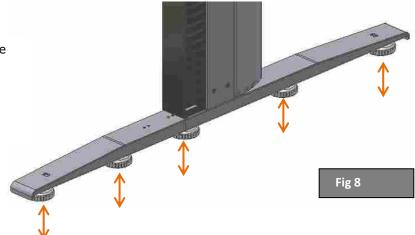

















Frame Assembly Instructions

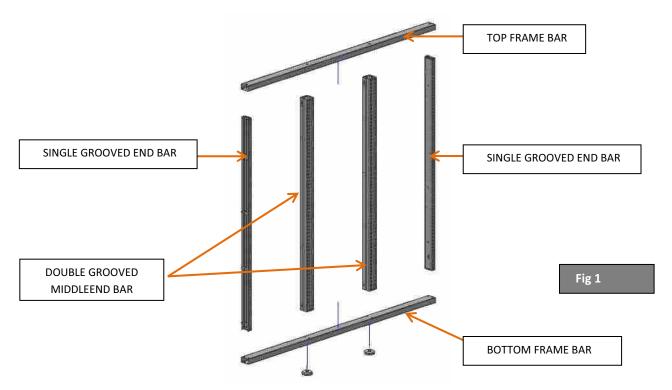

Assembly process

Graphic assembly process




The **frame** must be assemble horizontally, i.e. lying on the floor.

Frame Width	No double grooved middle bars	
600	-	
800	-	
1200	1	
1600	1	
1800	2	
2400 (600)	3	
2400 (800)	2	

STEP 1 – Position the **grooved bars** (the wide part of the groove must be facing upwards and the narrow part downwards) and the bottom bar (Fig. 2).

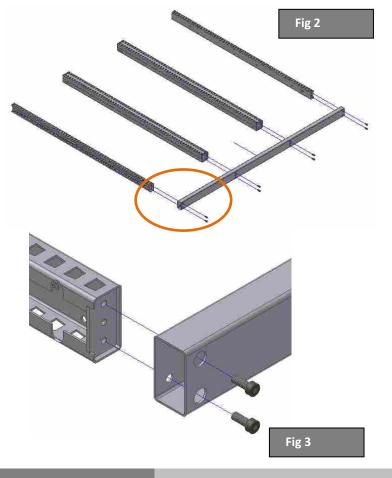
STEP 2 – Screw the **bottom bar** to the grooved bars with 2 **M8x20 DIN 912 Allen screws + M8 Grover washer** for each **bar** (Fig. 3).





TECNO Lanº

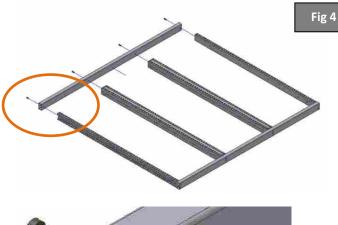STEP 3 – Position the **top bar** on the **frame** (Fig. 4)



STEP 4 - Screw the **top bar** to the **grooved bars** with 1 **M8x20 DIN 912 Allen screw + M8 Grover washer** for each **bar** (Fig. 5).

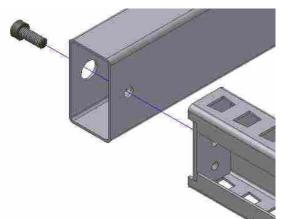


Fig 5

STEP 5 – Check one of the two **frame** measurements shown below (Fig.6).

d1= inside frame measurement ord2 = measurement betweentrapezoids of the grooved bars.

For 600mm sections:

d1= 530mm

d2 = 565mm

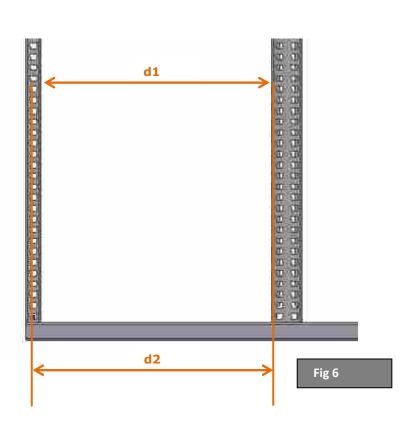
For 800mm sections:

d1= 730mm

d2 = 765mm




It is important to ensure this measurement is correct because the correct assembly of the accessories depends on it.







TECNOLAN®

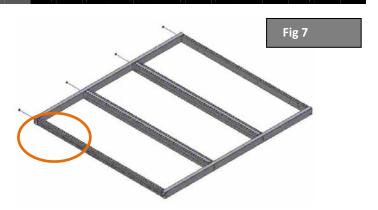


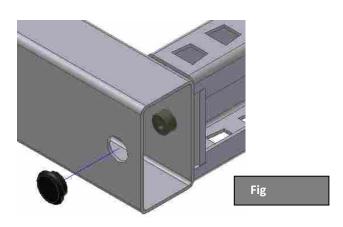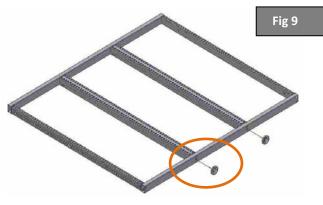STEP 6 – Position the plugs in the holes of the **top bar** (Fig. 7 and 8).





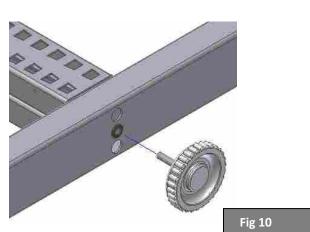STEP 7 – Screw the **levellers** onto the rivets of the **bottom bar** (Fig. 9 and 10).






TECNOLAN®

MOBILE FRAME:

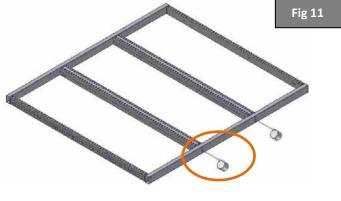The only difference in the **mobile** base frame is that the **levellers** are replaced by **wheels** (Fig. 11).



STEP 7b – Screw the **wheels** on to the rivets of the **bottom bar** (Fig. 12).



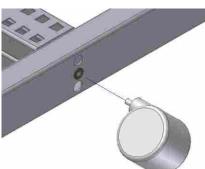


Fig 12

PANEL FRAME:

 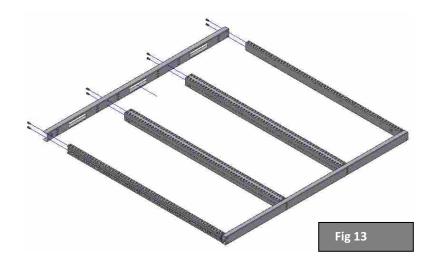The only difference between the **frames** is the replacement of the **top bar** (tube) for a U-shaped profile. The plugs of Step 6 do not need to be placed.








TECNOLAN[®]

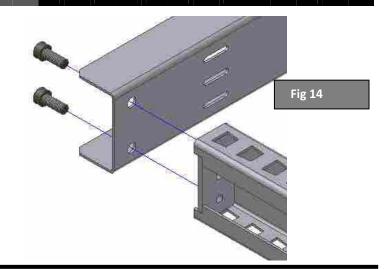STEP 4b – Screw the **top profile** to the **grooved bars** with 2 **M8x20 DIN 912 Allen screws** (Fig. 14)






The only **frame** height in which **panels** are not mounted is 740mm.

STRAIGHT CONSOLE FRAME:

The only difference between **frames** is the replacement of the 40mm high **top bar** (tube) by a 10mm C-shaped profile.
The plugs of Step 6 do not need to be placed.

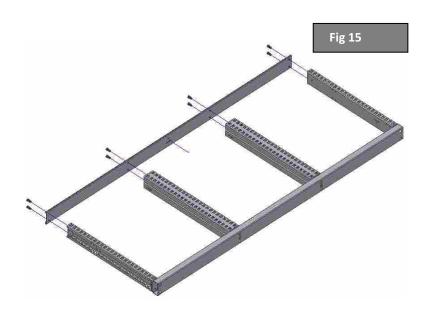STEP 3c – Position the C-shaped profile on the **frame** (Fig. 15).



STEP 4c - Screw the **top profile** to the **grooved bars** with 2 **M8x20 DIN 912 Allen screws** (Fig. 16)




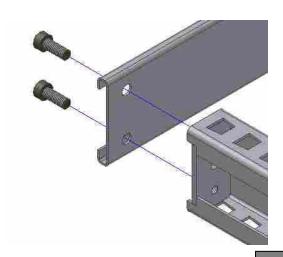


Fig 16

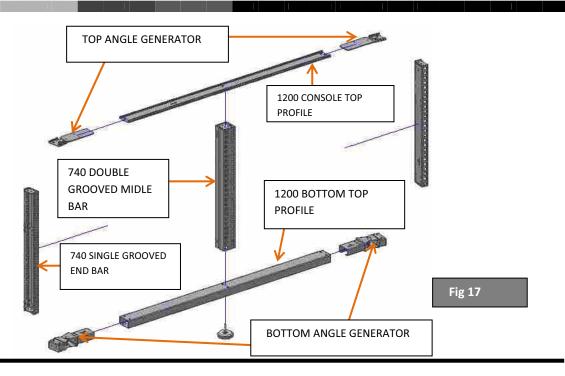








The **angle frame** starts from the base of the **1200 straight frame** (607-2-1210).


There is only one height in the console frame: 740mm.

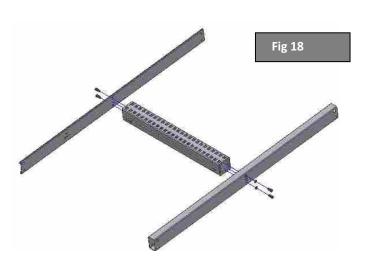STEP 1 – Assembly of the "I" body of the frame: position the 1200 console top profile and the 1200 bottom frame bar on the 740 middle double bar (Fig. 18).



The wide part of the groove of the **middle bar** must be facing upwards and the narrow part downwards (Figs. 19-20)

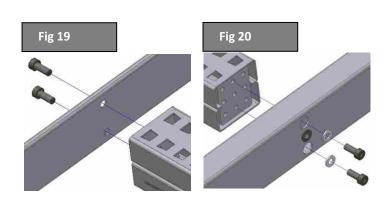Screw at the top with 2 M8x20 DIN 912 Allen screws (Fig. 19). At the bottom, the same but adding 2 ø8 Grover washers (Fig. 20).







STEP 2 – Screw the **leveller** to the rivet of the **bottom bar** (Fig. 21)

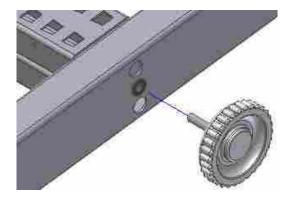



Fig 21


STEP 3 – Join the **generator** to the **frame**, both on the **top profile** and on the **bottom bar** (Fig.22)



At the top, insert the **generator plate** in the **profile** and screw at the bottom with **2 M6x10 ISO 7380 Allen screws** (Fig. 23).

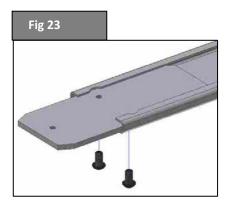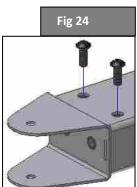At the bottom, insert the **female generator** into the **bar** and screw at the top with **2 M6x16 ISO 7380 Allen screws** (Fig. 24).











STEP 4 – Join the **generator** to the **bar**, both at the top and the bottom (Fig.25)

At the top, mount the **generator profile** to the **bar** and screw it on with **2 M8x20 DIN 912 Allen screws** (Fig. 26).

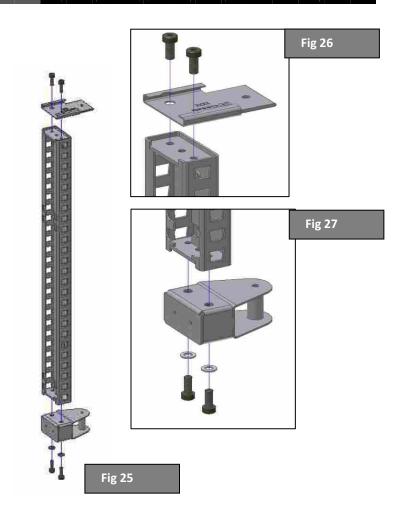At the bottom, mount the male generator to the bar and screw it on with 2 M8x20 DIN 912 Allen screws + ø8 Grover washers (Fig. 27)



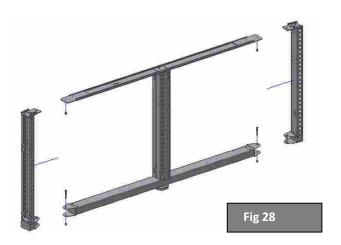
STEP 5 – Assemble the **740 single end bar** to the **"I" frame,** i.e. join the two parts of the **generator** (Fig. 28)







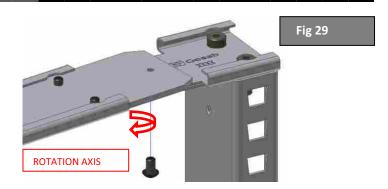
At the top, screw both parts of the **generator** (plate and profile) from below with **1 M6x10 ISO 7380 Allen screw** (Fig. 29).



At the bottom, assemble both parts of the **generator**; screw from above with **1 M6x55 ISO 7380 Allen screw** and **M6 DIN785 lock nut** (Fig. 30)



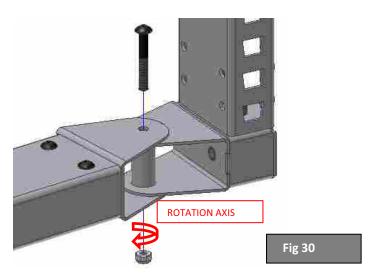The latter will be tightened once the angle with the **tray** has been adjusted.




GENERATOR FOR 60° AND 90° ANGLES:

The only difference is that in the part of the generator concerning the **740 single end bar** an **adapter** must be added to the bottom and at the top the **profile** is longer (Fig. 31)

STEP 4b – At the top, mount the **long generator** profile to the **bar** and screw it on with **2 M8x20 DIN 912 Allen screws** (Fig. 32).

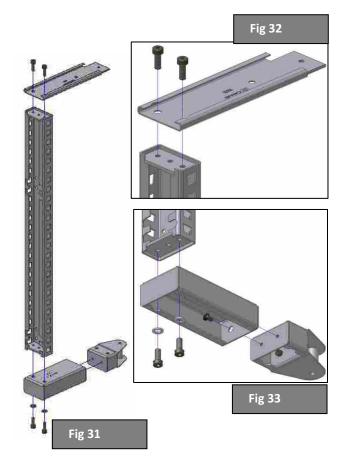
At the bottom, mount the male generator + extension kit with 2 M6x16 ISO 7380 Allen screws. Join the kit to the bar from below with 2 M8x20 DIN 912 Allen screws + ø8 Grover washers (Fig. 33)









EJEMPLOS DE MONTAJE:

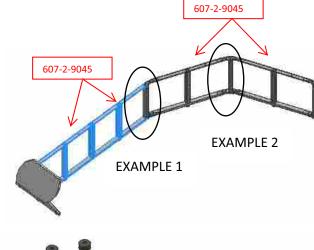

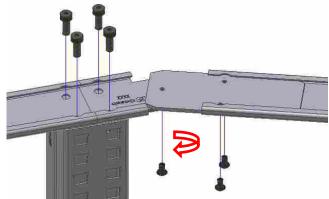


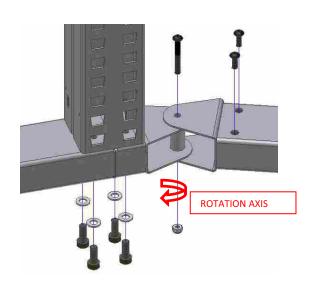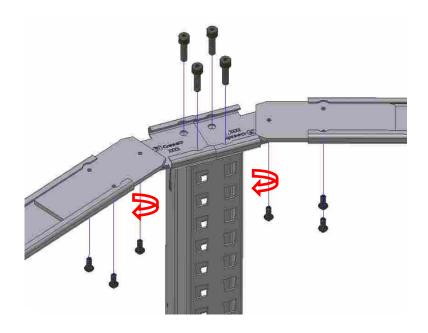1.- STRAIGHT FRAME + FRAME JOINT: It is just a case of replacing the assembly on the **740 single end bar** for the **740 double middle bar** (the picture does not show the frame joint foot)










2.- 2 ANGLE FRAMES + FRAME JOINT:

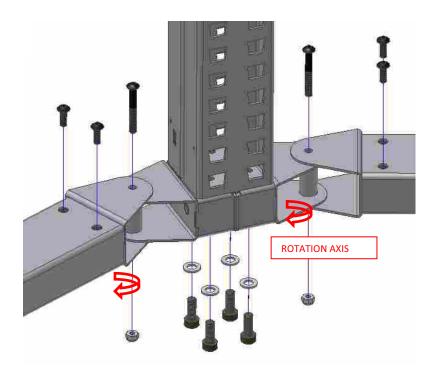
It is just a case of replacing the assembly on the **740 single end** bar for the **740 double middle** bar on both frames (the picture does not show the frame joint foot)








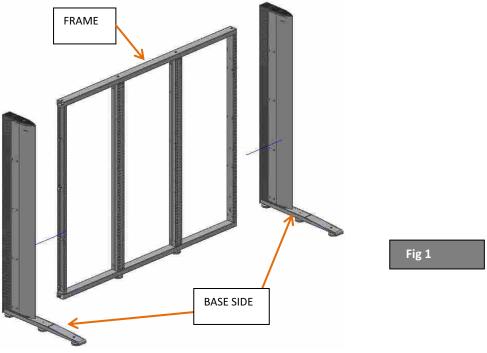
<u>Base Side + Frame Assembly Instructions</u>



Assembly process

  Graphic assembly process










TECNOLAN®

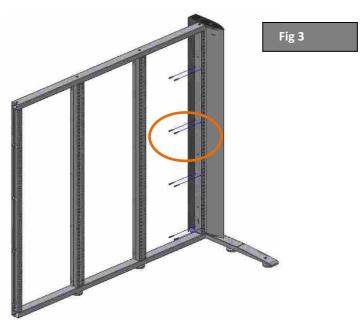STEP 2 – Screw the **frame** tightly to the **side** with **M6x45/55 ISO7380 Allen screws** (Fig. 3 and 4)





Before tightening all the screws, it is advisable to pre-assemble one top screw and one bottom screw.

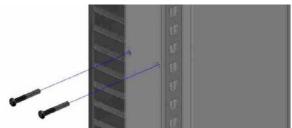


Fig 4

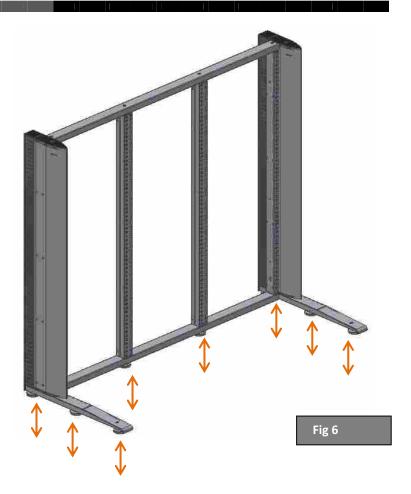


STEP 3 – Position the other **side** and screw it in place as explained in the two previous steps (Fig. 5)






STEP 4 – Level the whole structure using the **levellers** of the **frame** and **sides** (Fig. 6)







Connecting Post Assembly Instructions

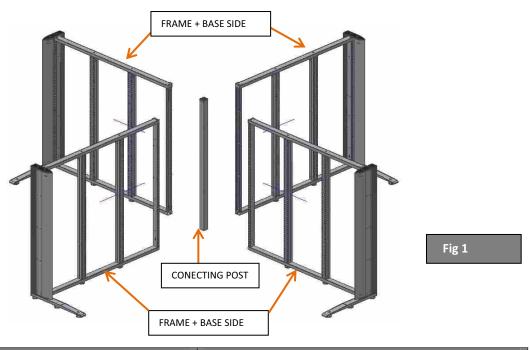


Assembly process

Graphic assembly process



The minimum number of **frames + base sides** that can be mounted to the **connecting post** is 3 (for T-shaped arrangements), and the maximum 4 (for cross-shaped arrangements).

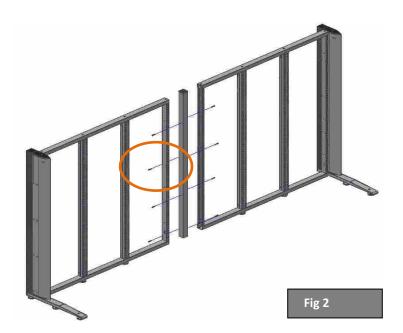
STEP 1 – First mount a line structure (Fig. 2)







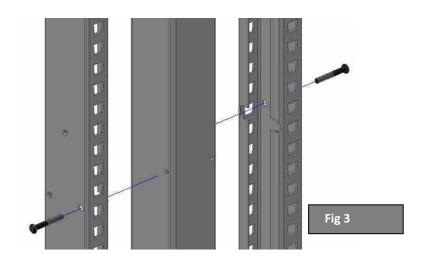STEP 2 – Screw the structures to the **connecting post**. Just one **M6x45 ISO7380 Allen screw** per row and in diagonal form (Fig. 3)



STEP 3 – Mount the other row of structures and screw them in place (Fig. 4)







Frame Joint Assembly Instructions

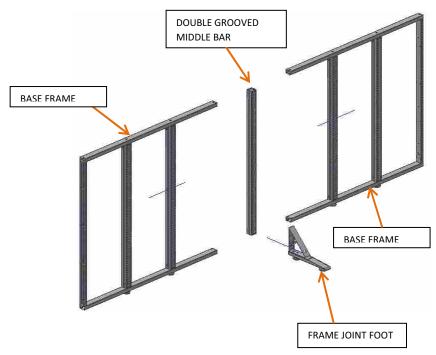


Fig 1

Assembly process

Graphic assembly process



The **frame** must be assembled horizontally, i.e. lying on the floor. The **base frame** assembly is explained in chapter **3** of the assembly guide.

STEP 1 – Position all the components of the **frames** on the floor. At the point where the two **frames** meet, place a double bar to act as a joint (Fig. 2)


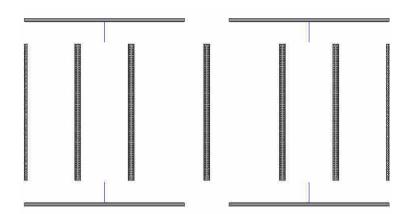


Fig 2

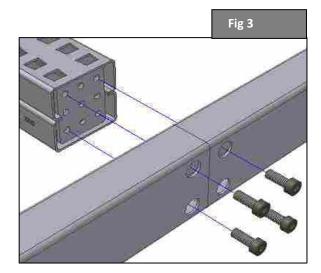




STEP 2 – Screw the **bottom** and **top bars** to the grooved bars.
On the **double joining bar**, 4 screws are needed at the bottom (Fig.3) and **2 M8x20 DIN 912 Allen screws** at the top (Fig. 4).






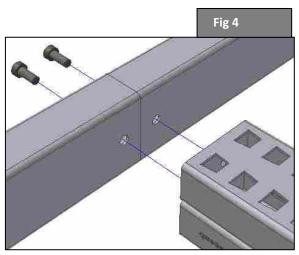Remember to check the measurements between **frame** sections (see **base frame** assembly, chapter **3**)



STEP 3 – Insert all the **frame** plugs in the **top bars.** On the **double joining bar,** 2 are required (Fig. 5)

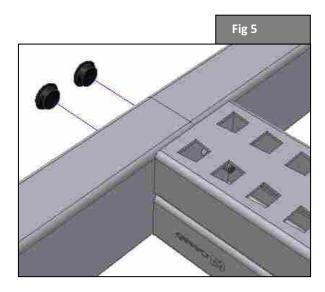
Mount all the **levellers** of the **frames.**








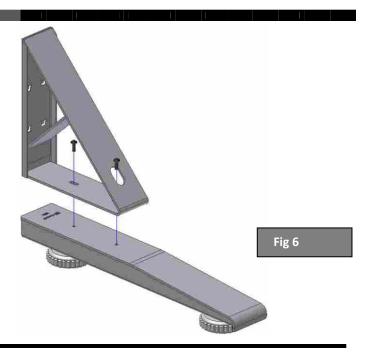STEP 4 – Mount the frame joint foot. Join the top bracket to the foot with 2 M6x16 ISO7380 Allen screws (Fig. 6). The two parts must be flush at the back.



STEP 5 – Position the **frame joint foot** on the already mounted structure (**frames + sides**) in a vertical position, i.e. standing (Fig.7).

Insert the hooks of the **foot** in the trapezoids of the **bar.** The **foot** has to be level with the other **feet**, i.e. it must touch the floor (Fig.8).

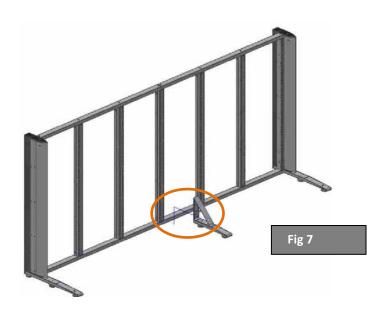



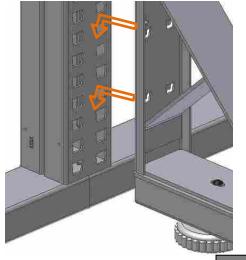


Fig 8

 

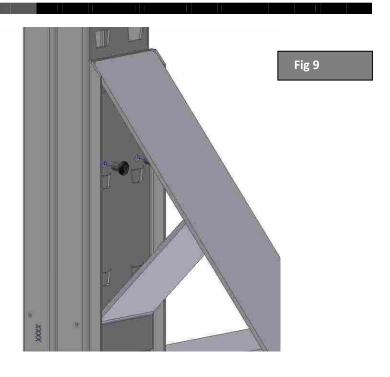





STEP 7 – Adjust the **structure** to the floor using all the **levellers** (Fig.10)


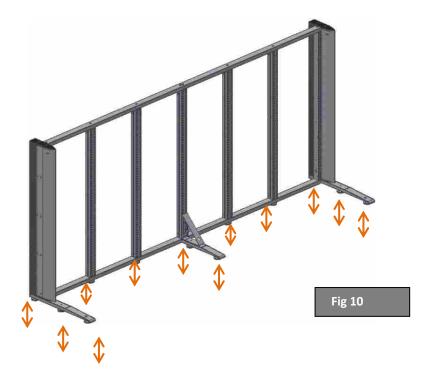




Fig 1

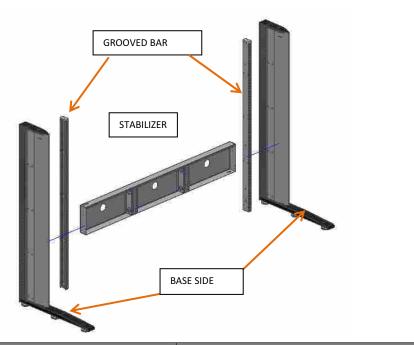

Stabilizer Assembly Instructions

 


Assembly process


Graphic assembly process



To mount a **stabilizer** to the first **side**, two people are required.



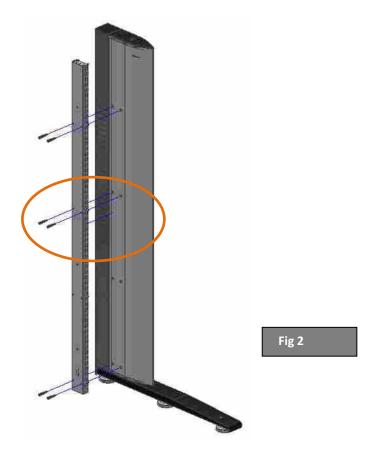If the **side** is a middle one, remove all the **trim screws.**






TECNOLAN®


Fig 3

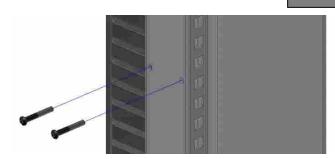STEP 2 – Screw the **bar** tightly to the **side** with **M6x10 ISO7380 Allen screws** (Fig. 3, except for the second row of screws starting from the bottom (Fig. 4).






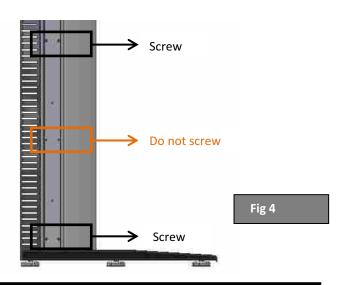Before tightening all the screws it is advisable to pre-assemble one top screw and one bottom screw.



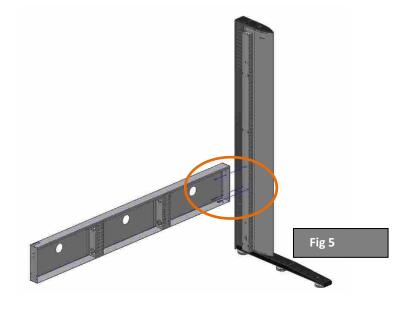
STEP 3 – Position the **stabilizer** and screw it to the **side** (Fig. 5).






TECNOLAN[®]

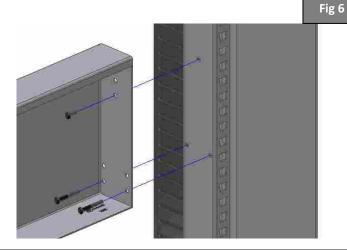To screw the **stabilizer** to the **side** + **bar**, use the row which was not used in the previous step (the second starting from the bottom, Fig. 4). You will need two **M6x55** and one **M6x16 ISO7380 Allen screws** per side as shown in Fig. 6.




STEP 4 – Position the other **side + bar** and screw it to the **stabilizer** as explained in the three previous steps (Fig. 7).

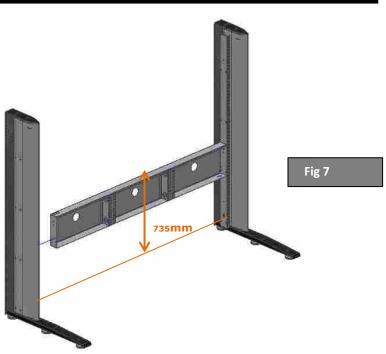Check that there are 735mm from the top of the **stabilizer** to the floor.



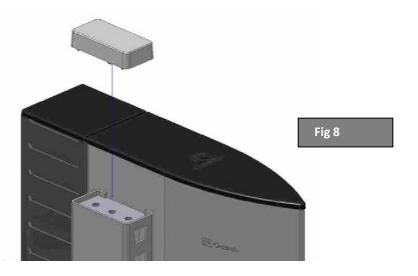
STEP 5 – Place the plastic covers at the tops of the **grooved bars** (Fig. 8).








(Fig.9).

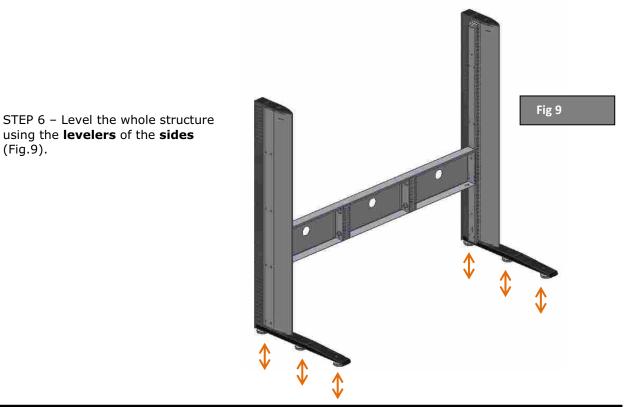

IN HEIGHT 740mm:


The **grooved bar** has to be raised 25mm above the level of the foot in order to be flush at the top of the side.

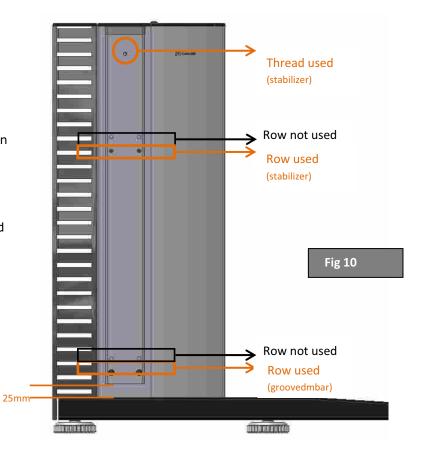Fig. 10 shows the rows used to assemble the **grooved bar** (the first starting from the bottom) and the **stabilizer** (the second row and upper thread).





Stabilizer Assembly Instructions

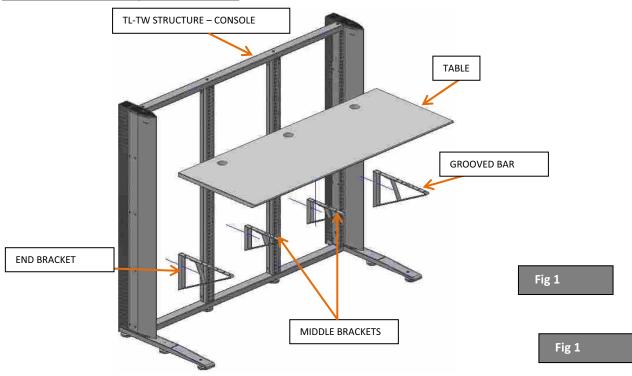

Assembly process

Graphic assembly process




At the sides of the **tables**, the **end brackets** (with 4 hooks) are always used. In the middle of the **1200**, **1600** and 1800mm wide **tables**, the **middle brackets** (with 3 hooks) are used.

See table below:

Table width	Nº end brackets	Nº middle brackets
600	2	-
800	2	-
1200	2	1
1600	2	1
1800	2	2

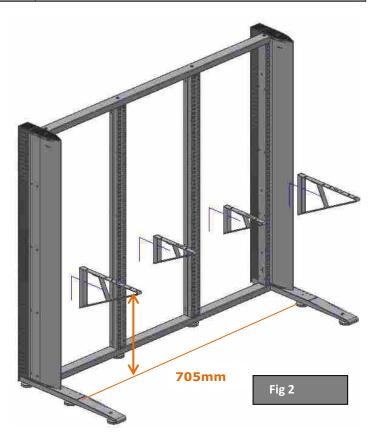
STEP 1 – Position the **brackets** on the **structure.** For a correct working height, the top of the **brackets** must be 705mm from the floor (Fig. 2).








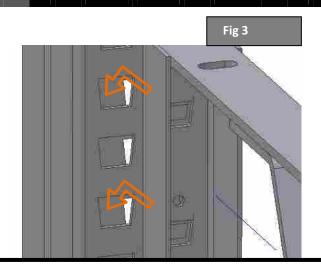Insert the hooks of the **brackets** into the trapezoids of the **frames** (Fig. 3). Use a nylon mallet.



CONSOLE TABLES:

STEP 2 – Mount the **safety screws (M6x10 ISO7380)** of the **brackets** to prevent them coming out of the trapezoid (Fig. 4 and 5).

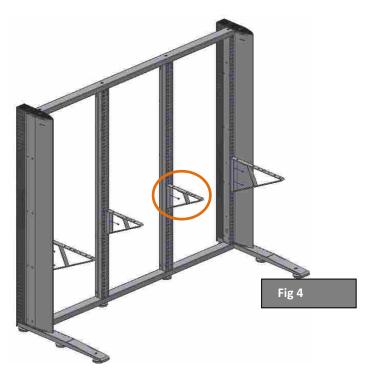


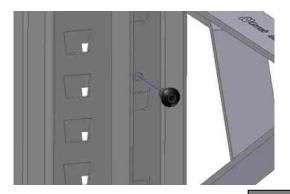



Fig 5

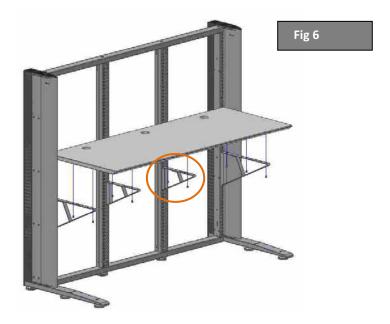



 STEP 3 - Place the table on the brackets and screw them from below with M6x12 DIN785 Phillips screws (Fig. 6 and 7).





In the console, leave the screws hand tight only; do not screw them in fully. (see step 4)



In the peninsula table, before placing the table on the brackets, the **foot** must be mounted (see step 2.5).


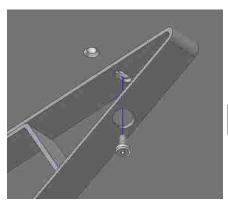


Fig 7

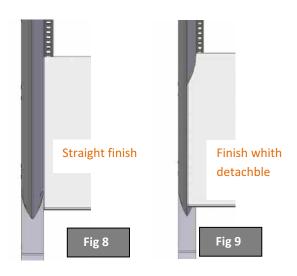
FINISH: Two types of finish can be chosen, as shown in Fig. 8 and 9. The **table** with finish with detachable (only up to half side) is used for making continuous lengths of table without leaving the middle space of the **side** and in angular arrangements. The table with straight finish is used for making independent stretches of table and for ending them.





TECNO Lanº

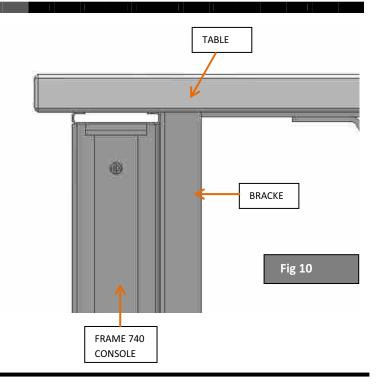The assembly of the **console tables** is the same; the only difference is that these go above the **frame** (Fig. 10).



STEP 4 - For middle tables:

Before tightening the table screws, mount the crescent eccentrics (one per side) used to join and adjust the tables (Fig. 11).

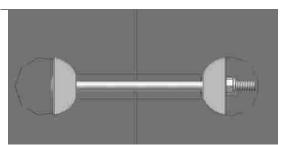


Fig 11

For end tables with agglomerate side:

Insert the M6x70 DIN913 screw in the side (Fig. 12).

Position the table and, before tightening the screws of the brackets, mount the eccentric on one side table-side (Fig. 13) and on the other the middle one, table-table (Fig. 11).

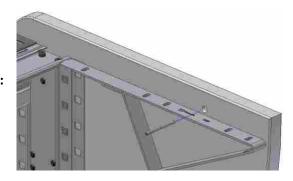


Fig 12

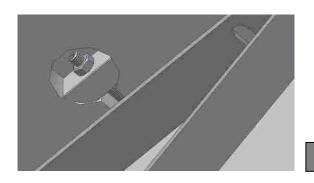


Fig 13





PENINSULA TABLE:

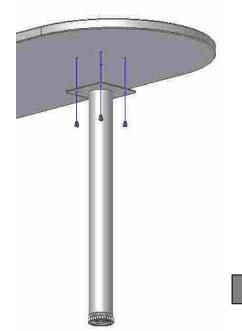


Fig 12

STEP 2.5 – Before placing the table on the brackets, mount the peninsula foot on the end using 4 M6x12 DIN785 Phillips screws (Fig. 12 and 13).


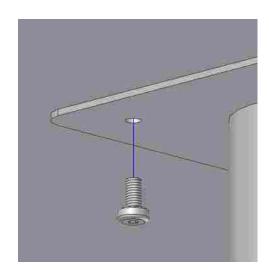


Fig 13

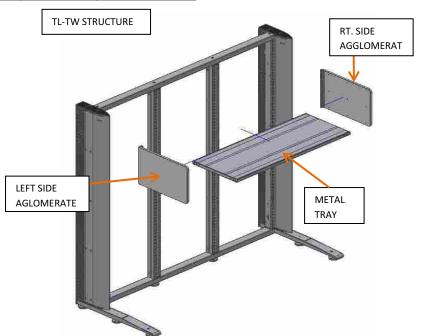



Metal Tray Assembly Instructions



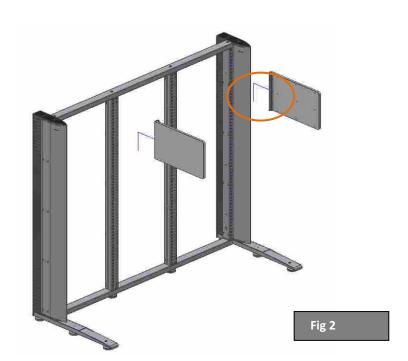
Assembly process

Graphic assembly process



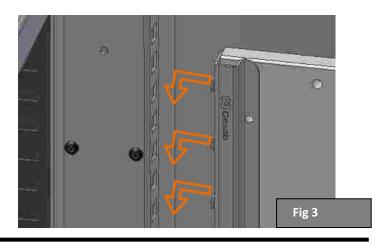
Assembly valid for all depths, widths and heights of side and angular arrangements. These trays can be mounted at any height.

STEP 1 – Insert the hooks of the **sides** in the trapezoids of the grooved bars. Both must be at the same height (Fig. 2 and 3).










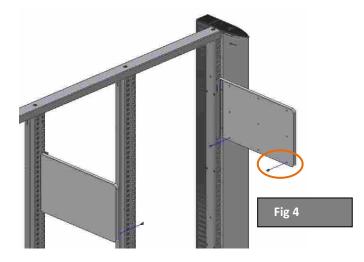STEP 2 – Insert the 4 M5x12 DIN785 Phillips screws of the ends of the sides without fully tightening them (Fig. 4 and 5).





In **tilt trays**, change only the side. See STEP 2b


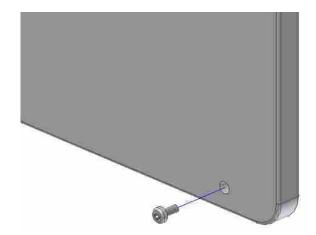



Fig 5

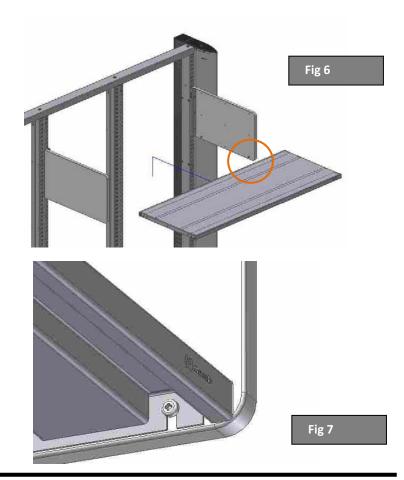






 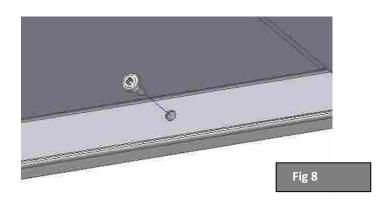STEP 3 – Position the **tray** in such a way that the previously mounted screws enter the slots in the same (Fig. 6 and 7)










TILT TRAYS:

The only difference with **tilt trays** is that the arrangement of the bushes on the **side** of these is diagonal in order to obtain the desired angle.

STEP 2b – Insert the 4 M5x12 DIN785 Phillips screws of the ends of the sides diagonally without fully tightening them (Fig. 9).



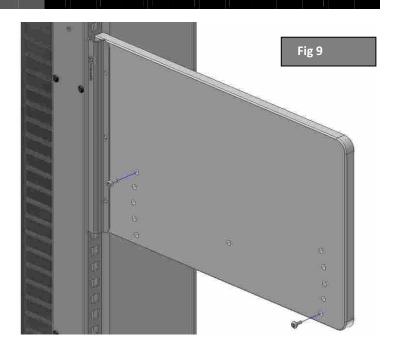
There are no **tilt trays** in angular arrangements.



HIDDEN SUPPORT:

This support is used to reinforce the **trays** when these have to support a heavy load.

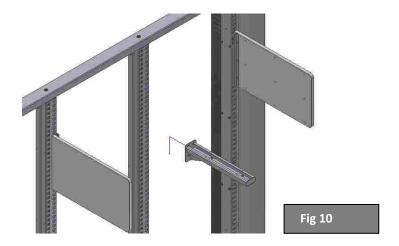Support valid for **trays** with lengths of 1200, 1600 and 1800mm, i.e. that have free **double bars** in the middle.



STEP 2.5 – Place the hidden support, using the hooks, on the middle double frame bar between the agglomerate sides of the metal trays (Fig. 10). Place it just below the sides (Fig. 11).


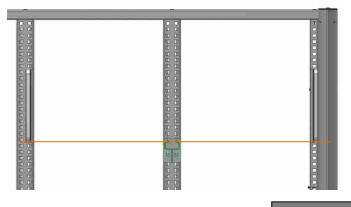


Fig 11

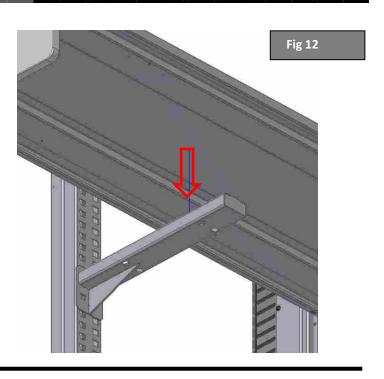




STEP 3.5 – Once in place, the **metal tray** must be perfectly leveled (Fig. 12).




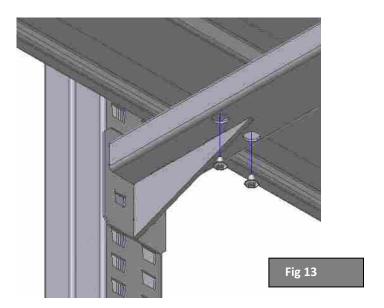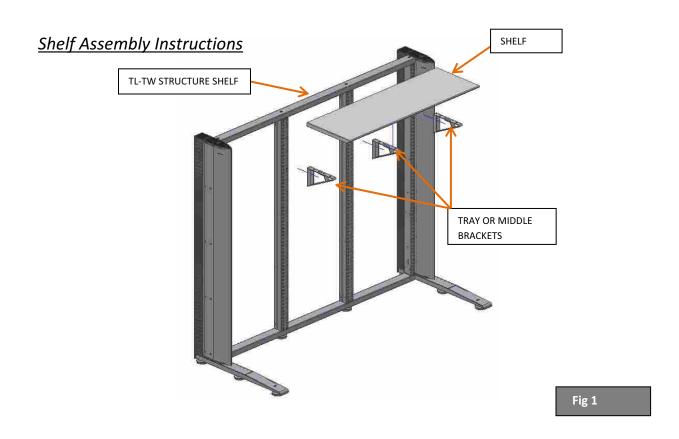STEP 4.5 – Machine Ø4mm holes under the **metal tray** (in the bottom profile) using the holes of the support as guides and screw in as many **4.9x13mm threaded screw-locks** (Fig. 13) as possible.









Assembly process


Graphic assembly process

Shelves with a depth of 300 and 400mm use tray brackets (height 130mm) and 500mm shelves use middle brackets (height 170mm).

See table below:

Shelf	Nº	Tray	Middle
width	brackets	Bracket	bracket
600	2	300/400	500
800	2	300/400	500
1200	3	300/400	500
1600	3	300/400	500
1800	4	300/400	500

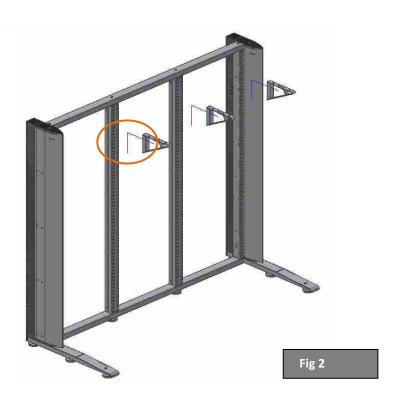
STEP 1 – Position the **brackets** on the **structure.** They must all be at the same height (Fig. 2).









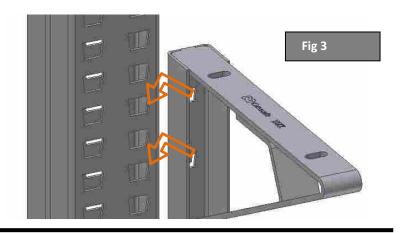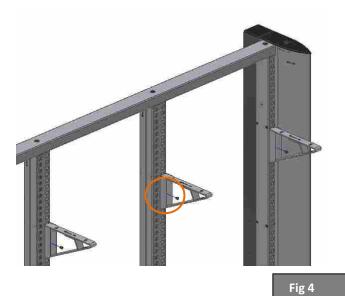Insert the hooks of the **brackets** in the trapezoids of the **frames** (Fig. 3). Use a nylon mallet.






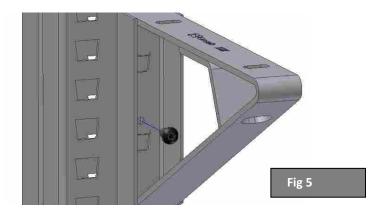STEP 2 – Mount the **safety screws (M6x10 ISO7380)** of the **brackets** to prevent them coming out of the trapezoid (Fig. 4 and 5).







TECNO Lanº

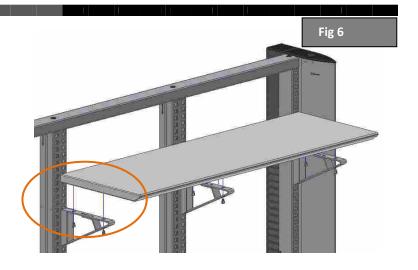

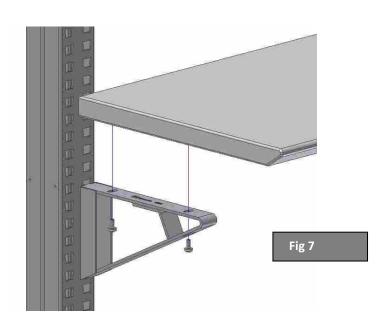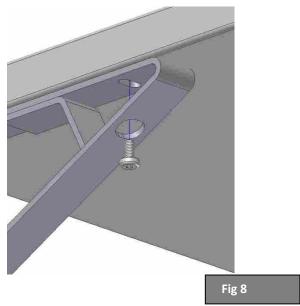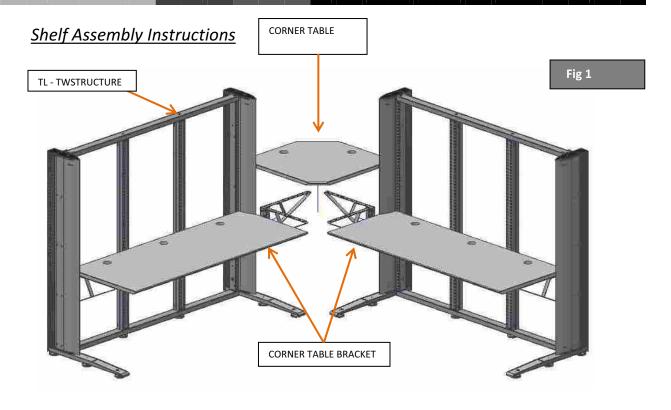
STEP 3 – Place the **shelf** on the **brackets** and screw them in place from below with **M6x12 DIN785 Phillips screws** (Fig. 6, 7 and 8).

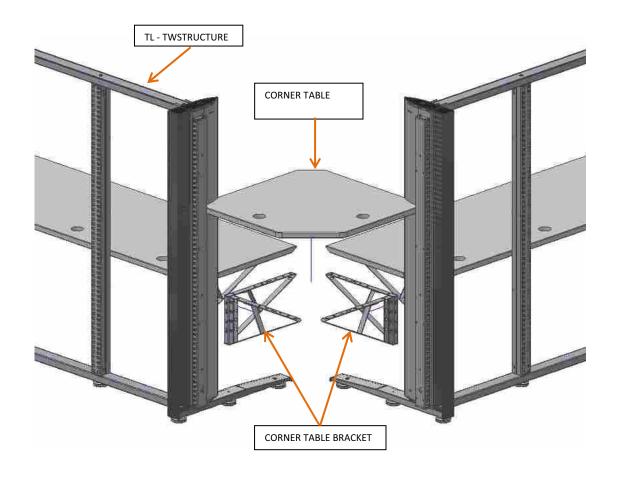


















For the assembly of both corner tables and corner shelves, two TL-TW structures are required for the attachment of the corner brackets.

STEP 1: Fully assemble the corresponding TL-TW structures and position them as shown in Fig. 3, so that the space between structures is similar to the shape and size of the corner table.


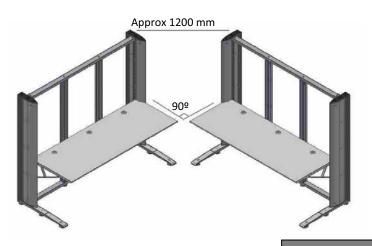


Fig 3

STEP 2:

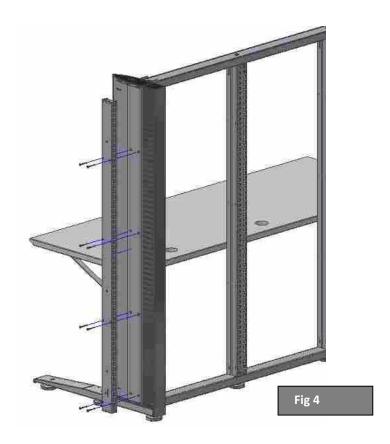- A) Position the **grooved** bars in the base sides where the corner brackets will be located (Fig. 4).
- B) Screw the **grooved** bar tightly to the side using M6x45/55 ISO7380 Allen screws (Fig.5).





Before tightening all the screws, it is advisable to pre-assemble one top screw and one bottom screw.


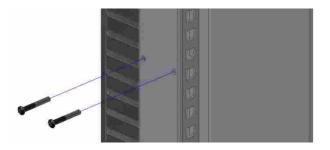


Fig 5

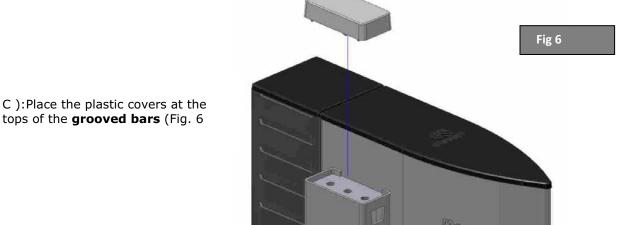






STEP 3- Outside the assembly: assemble the **corner bracket** formed by two **end brackets** (with 4 hooks).

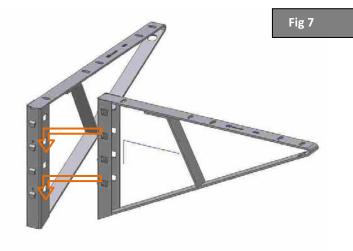
A) Insert the hooks of the **brackets** (1) in the trapezoids of the **bracket** (2) (Fig. 7). Use a nylon mallet.



B) Mount the safety screws (M6x10 ISO7380) between the brackets to prevent them coming out of the trapezoid (Fig. 8).



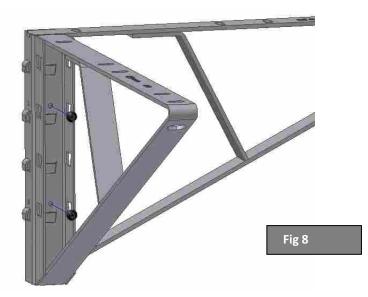The tops of the two **brackets** should be on a level for the placement of the **tables** or **shelves**.









STEP 4: A) Insert the hooks of the **corner bracket** in the trapezoids of the **grooved bar** (Fig. 8). Use a nylon mallet.



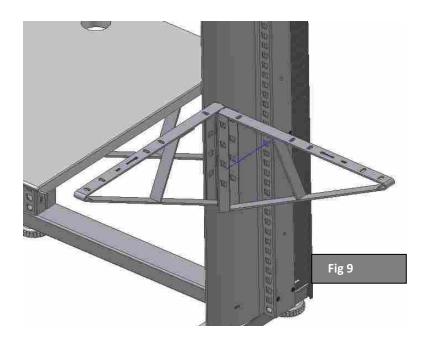They have to be on a level with the adjacent brackets in order for the **tables** to run continuously on from each other.



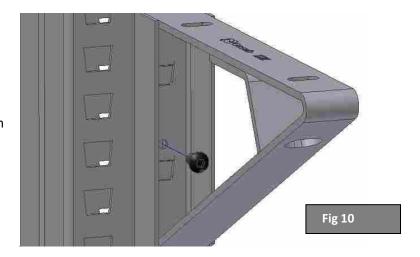
B) Mount the safety screws (M6x10 ISO7380) of the brackets to prevent them coming out of the trapezoid (Fig. 10).








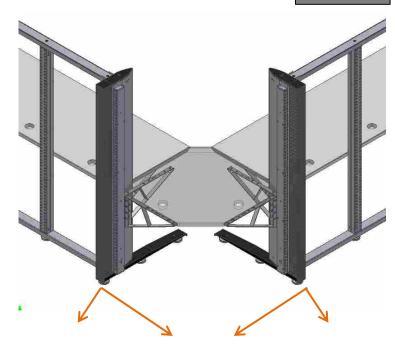STEP 5: Place the **corner table** on the **corner brackets** to reposition the **structure** correctly so that the **table** coincides with the adjacent ones.



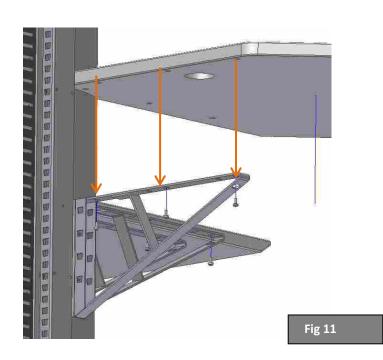STEP 6: Join the **corner table** to the **corner brackets** from below using **M6x12 DIN785 Phillips screws** (Fig. 12).










Shelves with depths of 300 and 400mm use double tray brackets (with 2 hooks) and 500mm shelves use double middle brackets (with 3 hooks).

See table below:

	Shelf width	Nº middle brackets
300	Х	
400	Х	
800		X

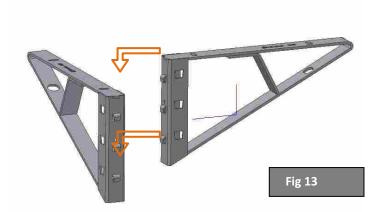

STEP 1- Outside the assembly: assemble the **corner bracket** formed by two **tray/middle brackets** (with 2-3 hooks).

- A) Insert the hooks of the **brackets** (1) in the trapezoids of the **bracket** (2) (Fig.13). Use a nylon mallet.
- B) Mount the safety screws (M6x10 ISO7380) between the brackets to prevent them coming out of the trapezoids (Fig. 14).



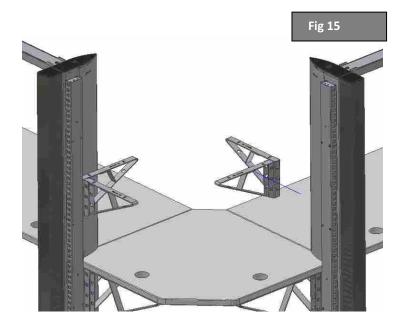


The tops of the two **brackets** must be on a level for the placement of the **tables** or **shelves**.






STEP 2: A) Insert the hooks of the **corner bracket** in the trapezoids of the **grooved bar** (Fig. 15). Use a nylon mallet.




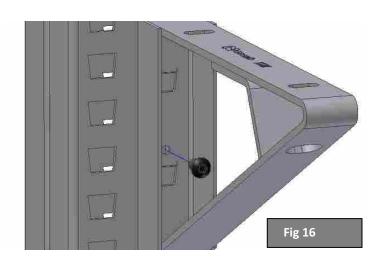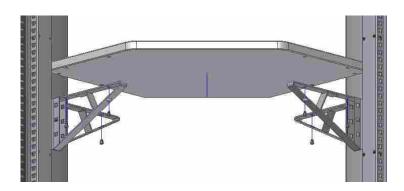B) Mount the **safety screws (M6x10 ISO7380)** of the **brackets** to prevent them coming out of the trapezoids (Fig. 16).










STEP 3: Position the **tray** and then join the **corner shelf** to the **corner brackets** from below using **M6x12**

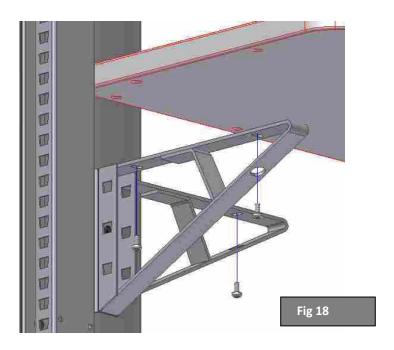
DIN785 Phillips screws (Fig. 17-18).







Duct Assembly Instructions

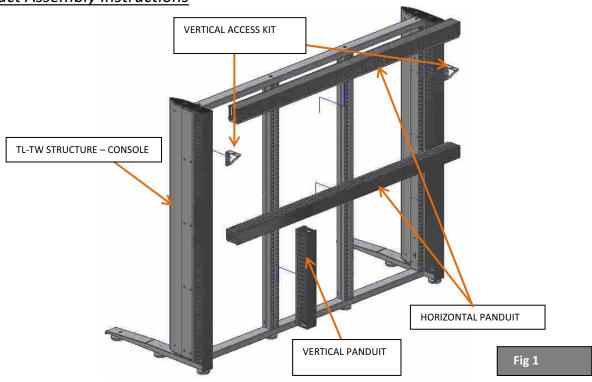

Assembly process

Graphic assembly process



- -Ducts valid for all products, **TL-TW** and **console**.
- -Height adjustable in any position.
- -Because of their assembly, whenever several **ducts** are required one over another, you must always assemble them from the bottom upwards.
- Can house terminal blocks (570-2-0008/9008)
- -Usually located behind and accessory (**trays, tables,** etc.) for routing cables (Fig.2).

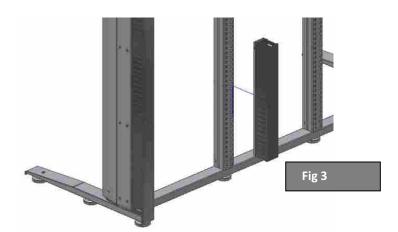


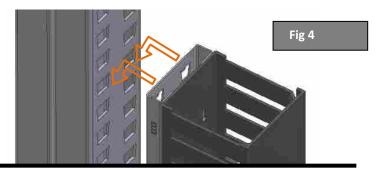




VERTICAL DUCTS:

STEP 1 – Insert the hooks of the **duct** in the trapezoids of the **double grooved bars** (Fig. 3 and 4). Use a nylon mallet.





HORIZONTAL DUCTS:

STEP 1 – Insert the hooks of the **duct** in the trapezoids of the **grooved bars** (Fig. 5 and 6). Use a nylon mallet.



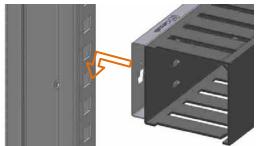





Fig 6





VERTICAL ACCESS KIT:

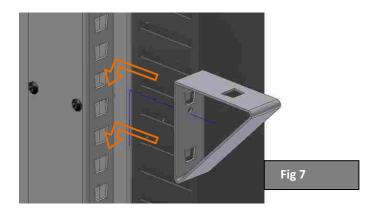STEP 1 – Insert the hooks of the **kits** in the trapezoids of the **grooved bars** (Fig. 7). Use a nylon mallet.



STEP 2 - Mount the **safety screws (M6x10 ISO7380)** of the **kits** to prevent them coming out of the trapezoids (Fig. 8).



Fig 8

STEP 3 – Insert the hooks of the **horizontal ducts** in the trapezoids of the **kits** (Fig.9).

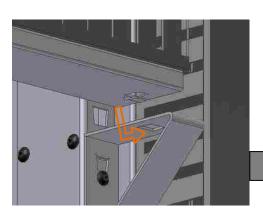


Fig 9

STEP 2 - Mount the safety screws (4.9x13mm threaded screw-locks) to prevent the ducts coming out of the trapezoids (Fig. 10).



Kits are only mounted with horizontal **ducts**.


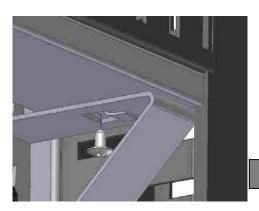


Fig 10

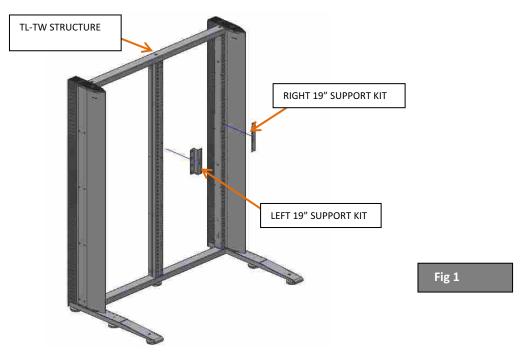



Support Kit Assembly Instructions



Assembly process

Graphic assembly process




The **19"** support kit can be mounted either at the front or back of any frame. There are kits for both 600 and 800mm sections.

STEP 1 – Insert the hooks of the **19" support kit** in the trapezoids of the **frames** (Figs. 2 and 3).
Use a nylon mallet.

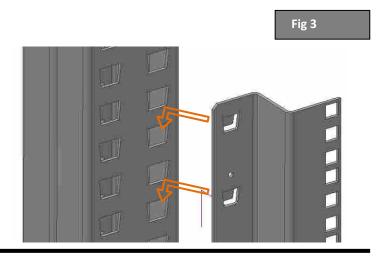
Fig 2








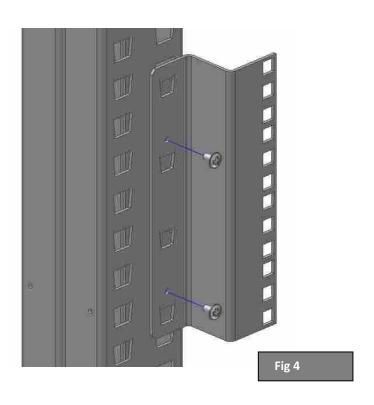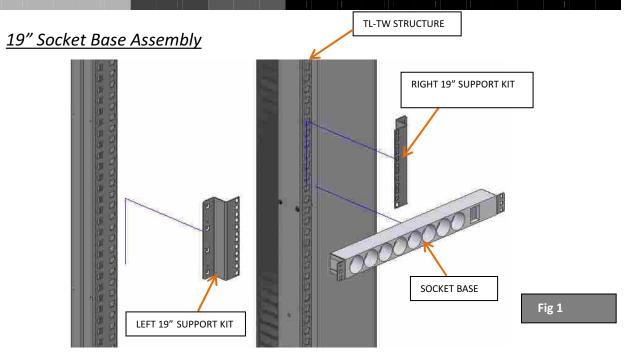STEP 2 - Mount the safety screws (3.9x13mm threaded screwlocks) of the 19" support kits to prevent them coming out of the trapezoids (Fig. 4).









Assembly process


Graphic assembly process



The **19" socket base** can be mounted either at the front or back of any **frame** and be adapted to both 600 and 800mm sections.

It can also be mounted in any PVC duct.

STEP 1 – Before installing the **19"** socket base, the **19"** support kit must be preassembled (Fig.2). (See chapter 13).

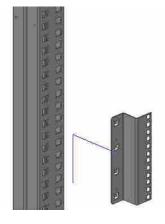


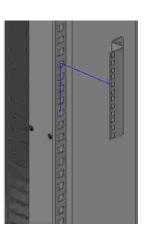


Fig 2

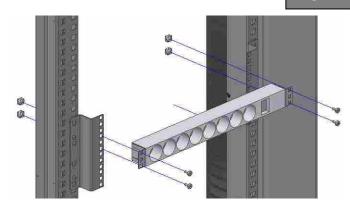







STEP 2 – Mount the 4 M6 caged nuts on one of the U's of the 19" support kit (Fig.4). Next screw on the 19" socket base using 4 M6x12 DIN785 Phillips screws (Fig.5).



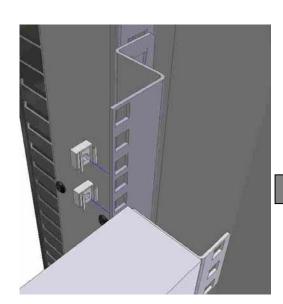


Fig 4

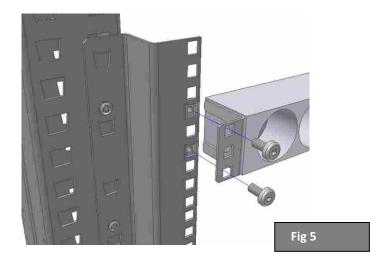

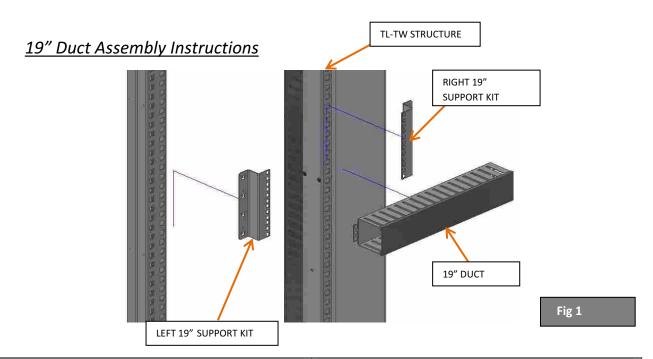





Assembly process

Graphic assembly process



The **19" duct** can be mounted either at the front or back of any **frame** and be adapted to both 600 and 800mm sections.

STEP 1 – Before installing the **19" duct,** the **19" support kit** must be preassembled (Fig.2). (See chapter 13).

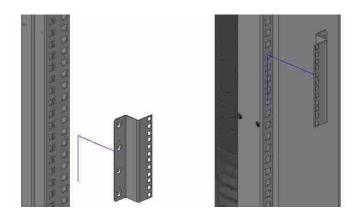


Fig 2






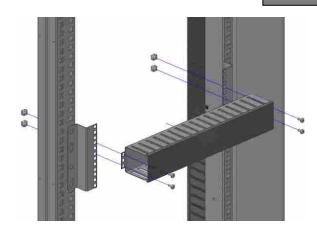


Fig 4

STEP 2 – Mount the 4 M6 caged nuts on one of the U's of the 19" support kit (Fig.4). Next screw on the 19" duct using 4 M6x12 DIN785 Phillips screws (Fig.5).

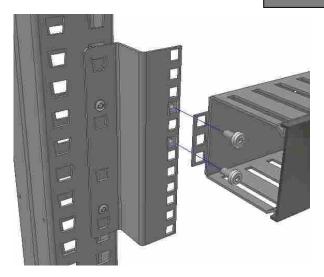


Fig 5








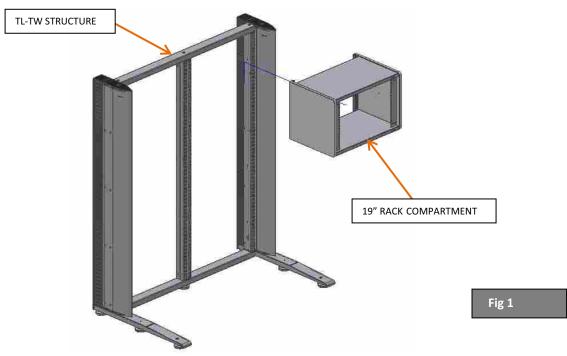19" Rack Compartment Assembly



Assembly process

Graphic assembly process

 


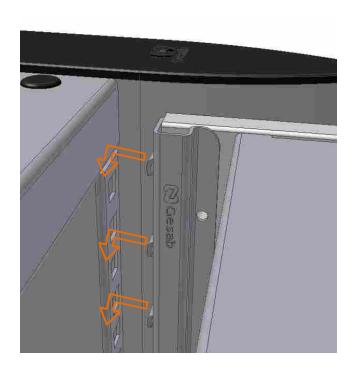


Fig 2

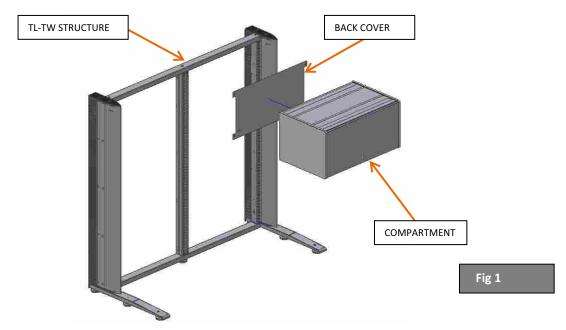





Compartment Assembly Instructions



Assembly process

 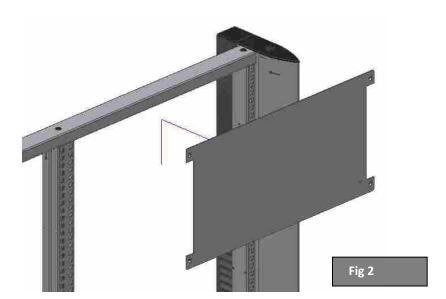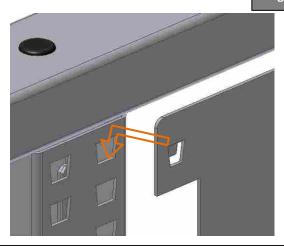
Graphic assembly process

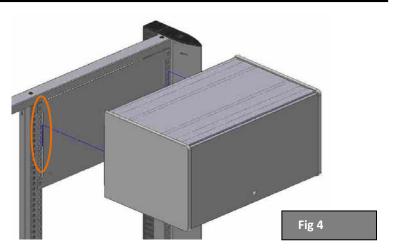












STEP 2 – Insert the hooks of the **compartment** in the trapezoids of the **frame** in the middle area of the **back cover** which is free (Fig.4 and 5).

Use a nylon mallet.


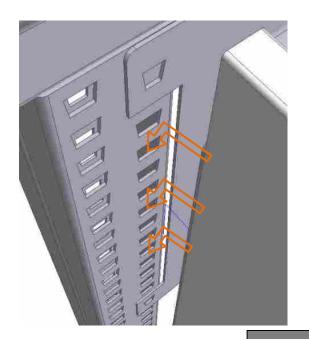


Fig 5

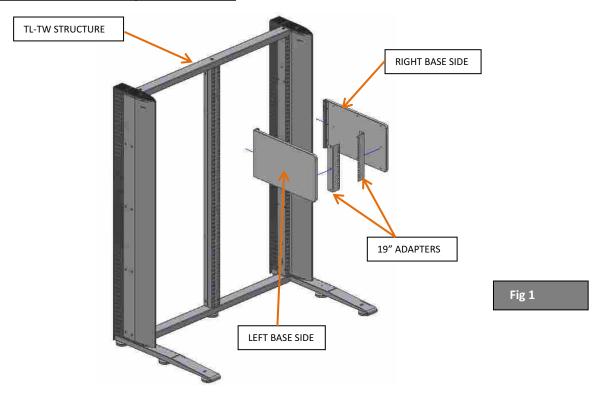



19" Rack Side Assembly Instructions



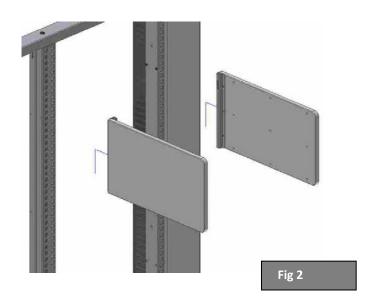
Assembly process

Graphic assembly process



There are **19" adapters** for both 600 and 800mm sections.

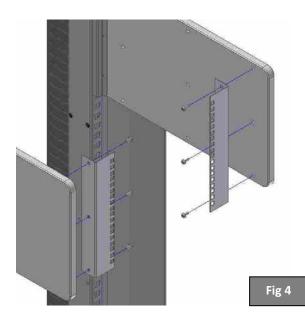
STEP 1 – Insert the hooks of the **base sides** in the trapezoids of the **frames** (Fig.2 and 3). Use a nylon mallet.











STEP 2 – Place the **19" adapters** on the firs column of the **base sides.** Then screw them together using **M5x12 DIN785 Phillips screws** (Fig. 4 and 5).


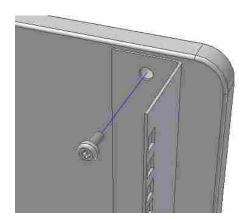


Fig 5

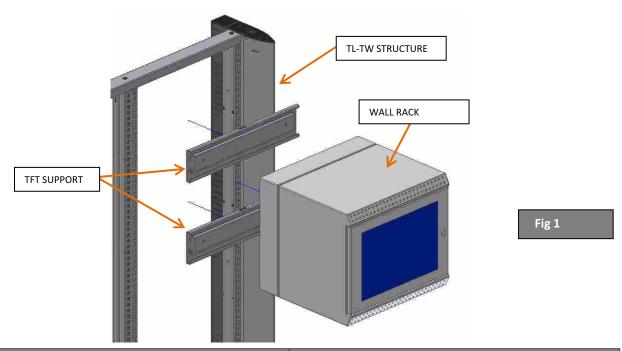



Wall Rack Assembly Instructions

 


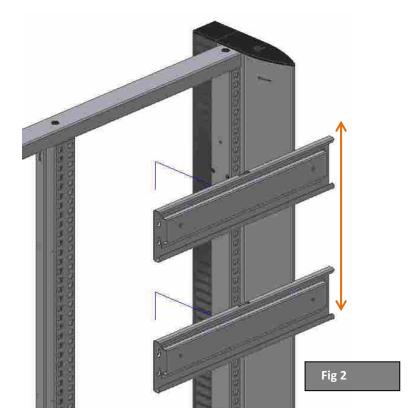
Assembly process

Graphic assembly process



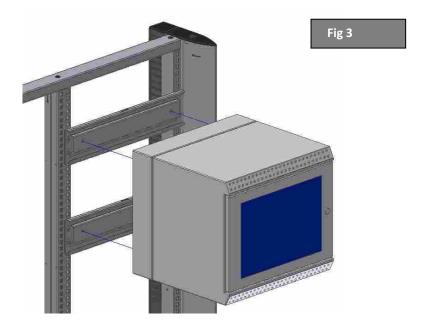
The wall rack is only used in **600mm** sections.












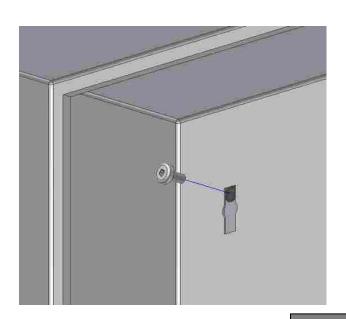
STEP 2 – Mount the wall rack on the TFT supports and fasten it from the inside with 4 M6x12 DIN785 Phillips screws (Fig. 3 and 4).







Panel Assembly Instructions

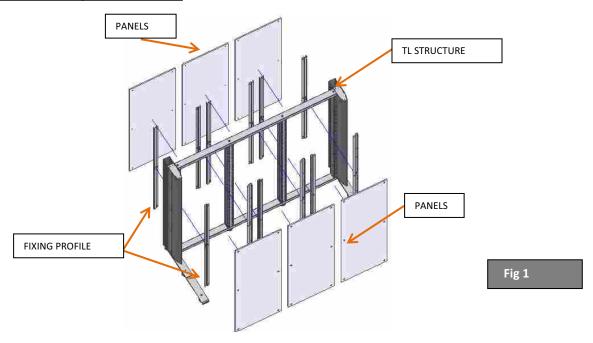


Assembly process

Graphic assembly process



- -The **double panel** always goes in the **600** or **800mm** sections.
- -Always mount one **panel** after another, not the two **panels** of the same section at the same time.
- -The only height which is not manufactured is **740mm.**
- -To mount the panels, it is not necessary to dismount a structure; they can be mounted afterwards.

 

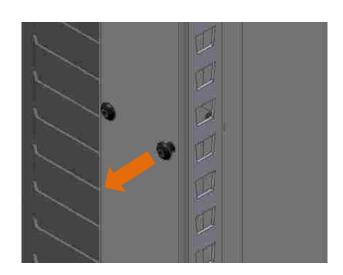


Fig 2





-On the middle double grooved bar of the frames, screw in the 3.9x13mm threaded screw-locks directly (Fig.3) or machine the holes for the ISO7380 Allen screws (Fig.4).

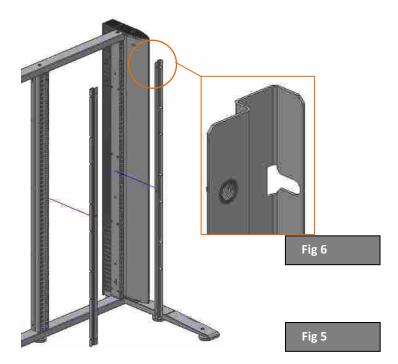


Fig 4



Do not fully tighten; leave some play in order to later place the fixing profile.





STEP 2 – Place the **fixing profiles** of the **panel** being mounted (Fig.5). The screw heads pass through the slots in the **profiles** (Fig. 6 and 7). Then tighten all the screws.

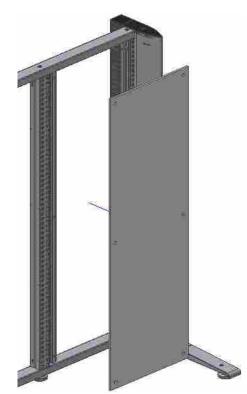



Fig 7





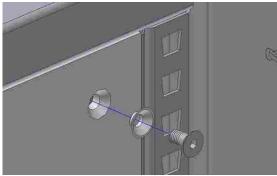STEP 3 – Insert the panel in the frame section (Fig.8). Assemble the panel to the fixing profiles using the M8x16 DIN7991 countersunk Allen screws + M8 grommet (Fig.9).





STEP 4 – Mount the **panel** of the same section but on the other side (Fig.10).

Mount the **panels** in each section

successively in the same way.

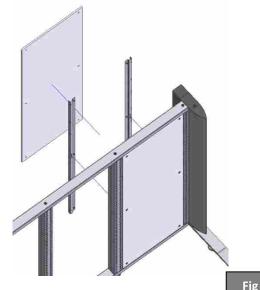


Fig 10





WALL BOX MOUNTING

STEP 1 – Break off the **stamped inlets** for wiring.

STEP 2 – Make the corresponding cut in the **panel** according to the number of modules of the box.

STEP 3 – Pass the wires on to the inside of the box. Attach it using the **fixing claw.**

The flap of the **box** should remain on the surface of the wall.



770-0200 770

770-0300

770-0400











STEP 4 – Wire and mount the circuit breaker to the DIN guide.



STEP 5 – Wire the **bases** to the **terminals** and fix the **power bases** to the **guides.**





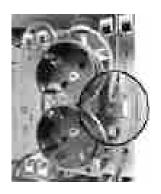




STEP 6 – Wire the bases to the terminals and fix the power bases to the guides.



STEP 7 – Insert the **connectors** in the corresponding **data plates.**



STEP 8 – Fix the **plates** to the **turrets**.
To remove a **plate**, push the **end clips** and lift the **plate**.



STEP 9 – Mount the **trim frame** and fasten is by pressing and turning the plastic screws through 90°.

In wall boxes with cover, the circuit breakers are installed without a cover.



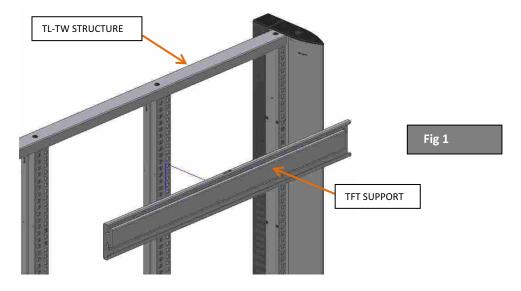










TFT Support Assembly Instructions



Assembly process

 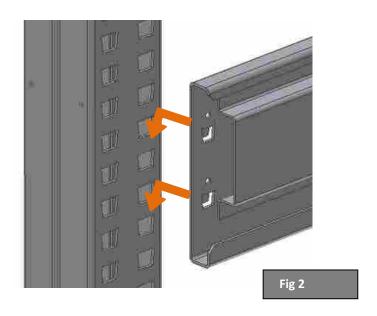Graphic assembly process










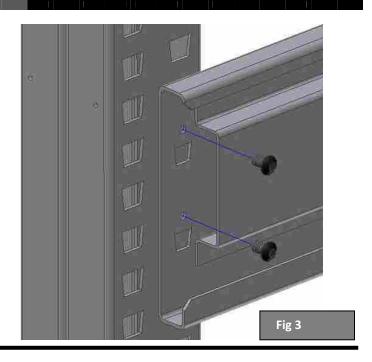STEP 2 – Mount the safety screws (M6x10 ISO7380 Allen screws) of the TFT supports to prevent them coming out of the trapezoid (Fig. 3).







Console Assembly Instructions

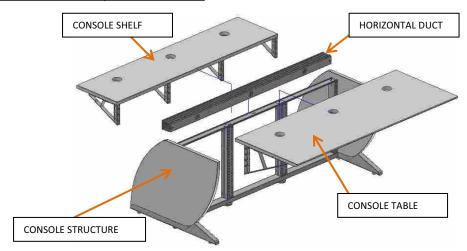



Fig 1

Assembly process

Graphic assembly process



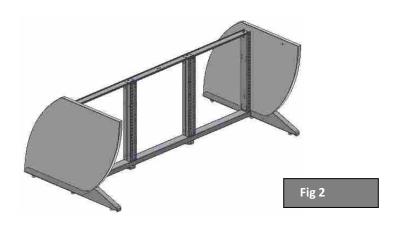Follow this assembly process when you wish to keep the horizontal duct between the console shelf and table.



STEP 1. – Assemble the console structure, i.e. console base frame with agglomerate console sides (Fig.2) or standard metal TL-TW sides (Fig. 3).

See assembly chapters: Base side + frame (4) Console side (23) Frame (3)

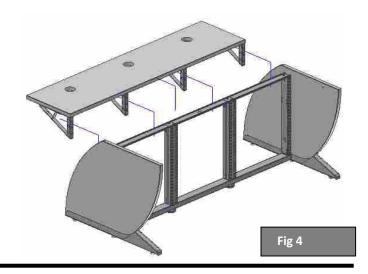







STEP 2 – Mount the **console shelf** with its **brackets** to the **base frame** of the **console** at the back (Fig.4).

See assembly chapter: Console shelf (24)




STEP 3 – Insert the hook of the horizontal duct in the first trapezoid of the base frame at the back (Fig. 5).

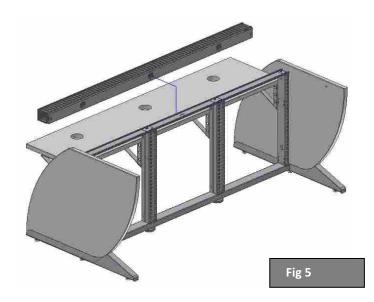See assembly chapter: Ducts (15)



STEP 4 - Mount the **table** with its **brackets** to the **base frame** of the **console** at the front (Fig.6).

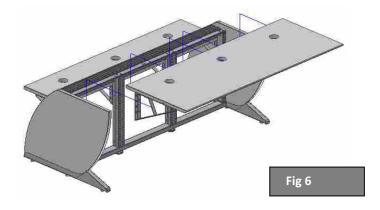
See assembly chapter: **Tables (24)**







Console Side Assembly Instructions

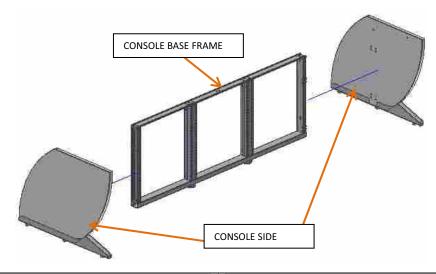

Assembly process

Graphic assembly process



This **side** is only mounted in **specific console frames**, i.e. **740mm height**. The **console** can use these **sides** or the **standard 740mm** of the **TL-TW**.

STEP 1 – Position the centre of the console side at the end of the console frame and then screw it in place with 9 M6x45 ISO7380 Allen screws (Fig.2).


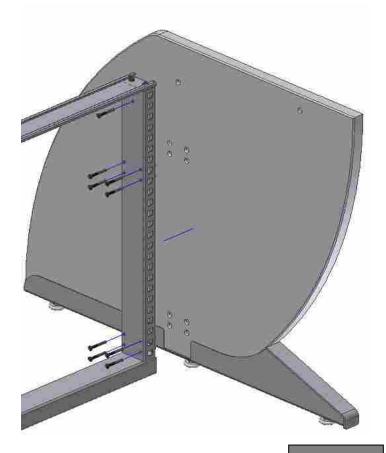


Fig 2

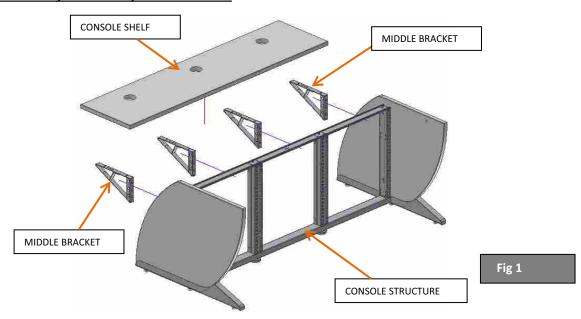

Console Shelf Assembly Instructions



Assembly process


Graphic assembly process



Shelves always use **middle brackets** (with 3 hooks).

See table below:

Shelf width	Nº middle brackets
600	2
800	2
1200	3
1600	3
1800	4
Angular	3

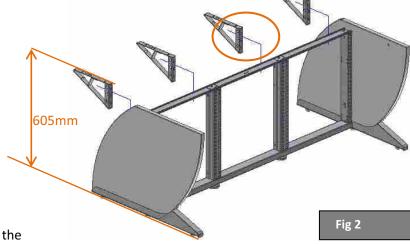


STEP 1 – Position the **brackets** on the **structure**, one on each **vertical bar** of the **frame**. In order to be able to place a **horizontal duct** between the **console shelf** and **table**, the top of the **brackets** must be 605mm from the floor (Fig.2) or, what amounts to the same, leave 3 full trapezoids of the **frame** visible at the top.






Insert the hooks of the **brackets** in the trapezoids of the **frames** (Fig.3).

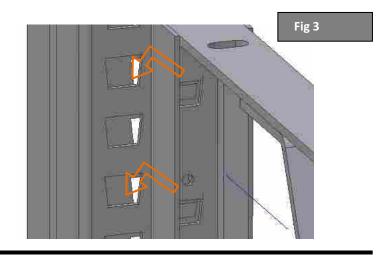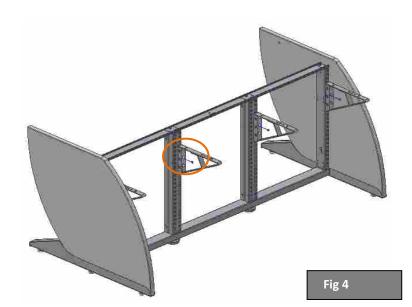Use a nylon mallet.





STEP 2 – Mount the **safety screws** (M6x10 ISO7380) of the **brackets** to prevent them coming out of the trapezoid (Fig. 4 and 5).


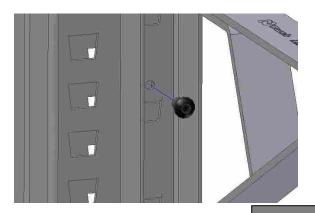


Fig 5

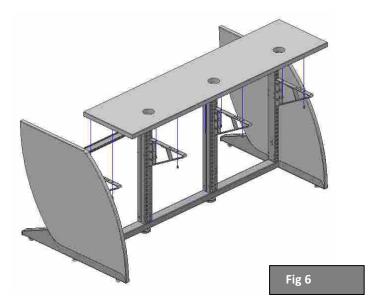



STEP 3 – Place the **console shelf** on the **brackets** and screw them from below with **NM6x12 DIN785 Phillips screws** (Fig. 6 and 7).



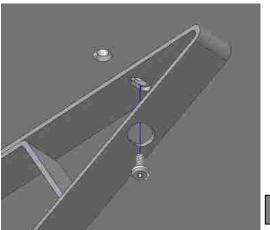


Fig 7

STEP 4 – When there are more than two **console shelves** one after the other, it is also necessary to mount the **crescent eccentrics** between them for better fitting and finish (Fig.8).


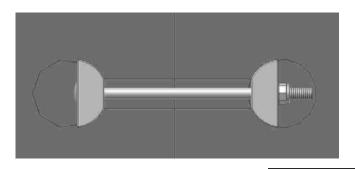


Fig 8

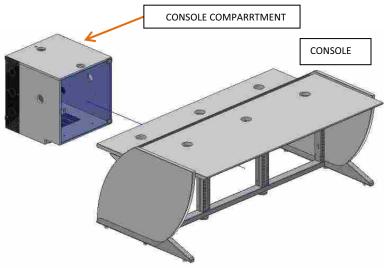



Console Compartment Assembly



Assembly process

Graphic assembly process



The minimum distance between the floor and the bottom of the console shelf in order to be able to place a buck beneath is 605mm.

Bucks are always mounted between the sections of the **base frames.**

STEP 1 – Differentiate the buck. The **side trim** is the key for knowing which side or type it is. If it has the two **trims** on both sides, it is an individual compartment (Fig.2. On the other hand, if it has no trim, it is a middle compartment, i.e. there will be another on either side because there are ATS (Fig.3). If it has a trim on one side only, it is either a left or right end compartment. On the side without trim, there will be another because there is ATS (Fig. 4 and 5).

Fig.2: Individual (660-2-0600)

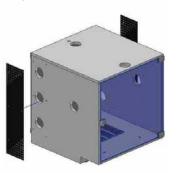


Fig.3: Middle (660-2-0630)

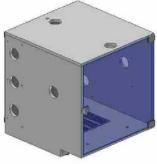


Fig.3: End left(660-2-0620)


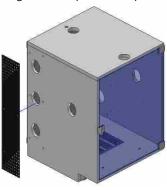



Fig.3: End right (660-2-0610)

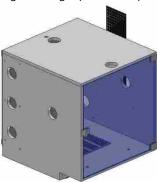






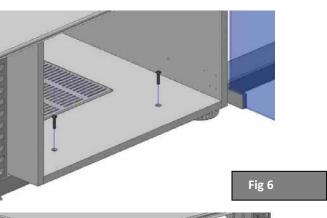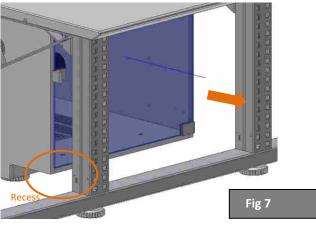STEP 2 – Insert the **console compartment** in the **frame section** until the bottom recess fits in place (Fig. 6 and 7).





STEP 3 – Block the possible movement of the **compartment** with **2 M6x25 ISO7380 Allen screws** at the front (Fig.8).


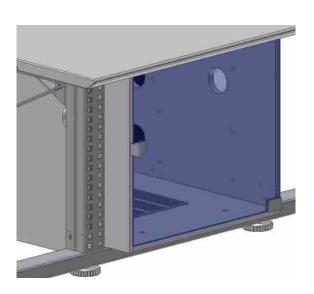


Fig 8

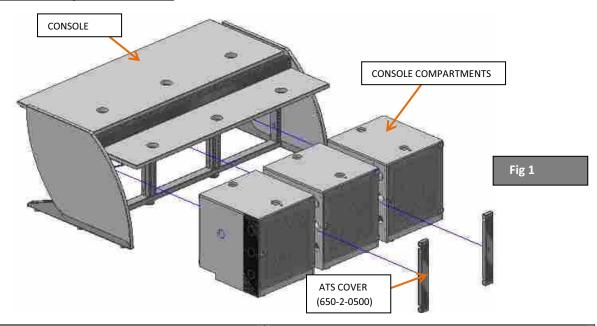



ATS Assembly Instructions



Assembly process

Graphic assembly process



To mount an **ATS cover**, you need at least two **compartments** running.

STEP 1 – Mount the console compartments at the back of the console (Fig.2).

See console compartment assembly chapter (25).

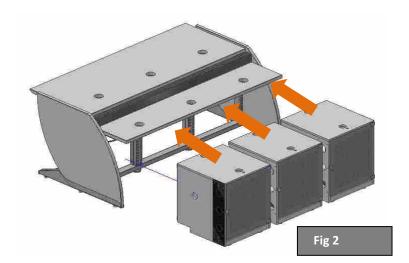


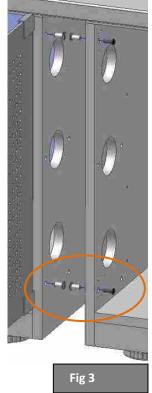



Fig 4



STEP 2 – Mount the fastening for the **ATS cover.**

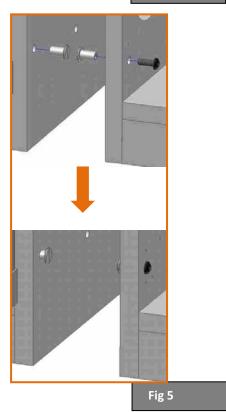On the inside of the ATS, mount the 4 M6 joining caps at the ends of the compartments at the back and on the inside 4 M6x16 ISO7380 Allen screws (Fig. 3 and 4).









Leave some play in the **caps**; do not tighten them fully (Fig.5).

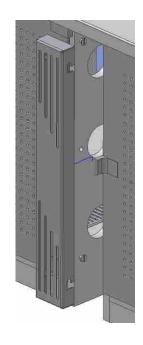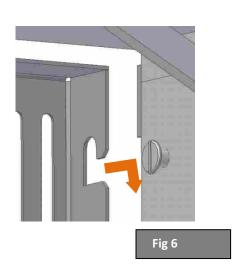STEP 3 – Fit the **ATS cover** on the internal **joining caps** of the **ATS**. Make a reverse "L" movement (Fig. 6 and 7).









ATS ACCESSORIES:

8 SOCKET BASE (570-2-0008 / 9008) Join with the 19" accessories of the base to the inside of the ATS using the two caps of the compartment + 2 M6 DIN7985 Phillips screws (Fig.9).



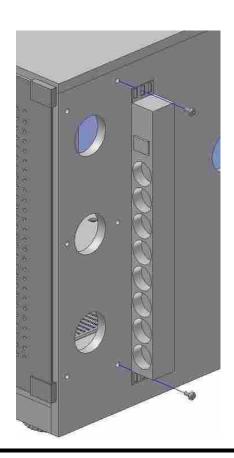


Fig 8





TECNO Lanº





www.gesabgroup.com info@gesabgroup.com

www.gesab.es info@gesab.es

Barcelona: 902 113 186

Madrid: 902 113 187

Internacional: +34 93 842 70 50

+34 91 534 50 54

87